


Datenblatt für Artikel: HSELDA49MP

FTTH falon kívüli doboz, sz80xma28xmé80mm 4xLC/APC 8°, OS2

G657.A2, RAL9010 fehér, kötéstartó, zsugorvédő, 2db duplex toldó és 4db pigtail tartozék

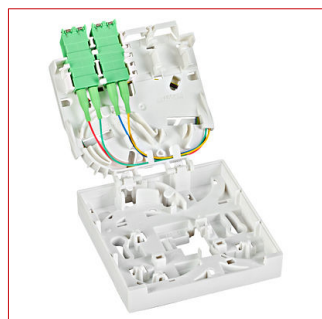

SCHRACK-Info

FTTH OS2 LC/APC outlets are designed for single-mode fiber optic cables, which offer long transmission distances and low attenuation.

The LC/APC connectors ensure that the fiber-optic connection is stable and reliable.

LC/APC connectors are preferred for compact installations and high connection density.

This type of connector is characterized by its precise mating and low return loss, resulting in minimal signal loss.

Features

- Fiber Optic In-House-Cabling

- Offers connection options for up to 4 end devices
- Inclusive 2x Duplex-Couplers and 4x Pigtails inserted and prepared ready for splicing

Optional Accessories

Coupler:

- HSELSK09MR

Pigtail:

- HLP09M041P

Safety information:

Avoid direct contact with light sources:

- Fiber optic cables—especially those with active light sources such as lasers (e.g., in optical communication systems)—can emit hazardous radiation that may damage the eyes.
- Never look directly into the light of a fiber optic cable, even if the light source is invisible to the naked eye.

Wear protective eyewear:

- When working with fiber optic cables, especially during tests or when using lasers, always wear safety glasses to protect your eyes from harmful radiation.

Handle cables correctly:

- Plug in and unplug cables only by holding the connector, and never pull directly on the cable.

Do not bend or crush:

- Fiber optic cables are sensitive to mechanical stress.

Protect from damage:

- Install cables in dedicated conduits or use protective materials to prevent physical damage.

Keep connectors clean:

- Fiber optic connectors must be free of dust and dirt.
- Even small particles on the connectors can significantly reduce signal quality.

Observe temperature limits:

- Do not expose cables to extremely high or low temperatures.
- Follow the manufacturer's specifications for the cable's maximum operating temperature.


Inspect regularly:

- Frequently check cables for visible damage such as cracks, bends, or signs of wear.
- Damaged cables must be replaced immediately.


Technische Daten

Nettó szélesség (mm)	80,00
Nettó magasság (mm)	28,00
Nettó tömeg (kg)	0,06
Szabvány	IEC 61300-3-4 / IEC 61300-3-6
Csatlakozó kombináció	LC/APC
Csatlakozó típusa	LC/APC 8° Ferrule
Szál	9/125 OS2 Singlemode / G.657.A2
Szín	RAL 9010 (hófehér)
Jellemző bemeneti veszteség (dB)	≤0,25
Jellemző visszaverődési veszteség (dB)	≥60
Hullámhossz (nm)	1310
Min. környezeti hőmérséklet (°C)	-40
Max. környezeti hőmérséklet (°C)	75


méretarajz: FTTH falon kívüli doboz, sz80xma28xmé80mm 4xLC/APC 8°, OS2

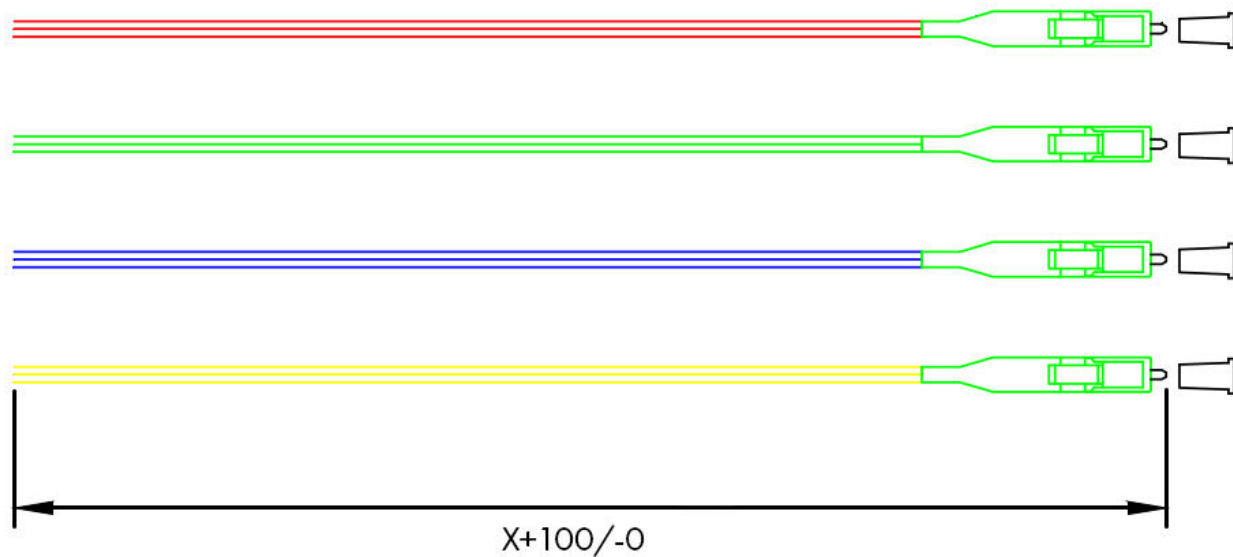

méretarajz: FTTH falon kívüli doboz, sz80xma28xmé80mm 4xLC/APC 8°, OS2

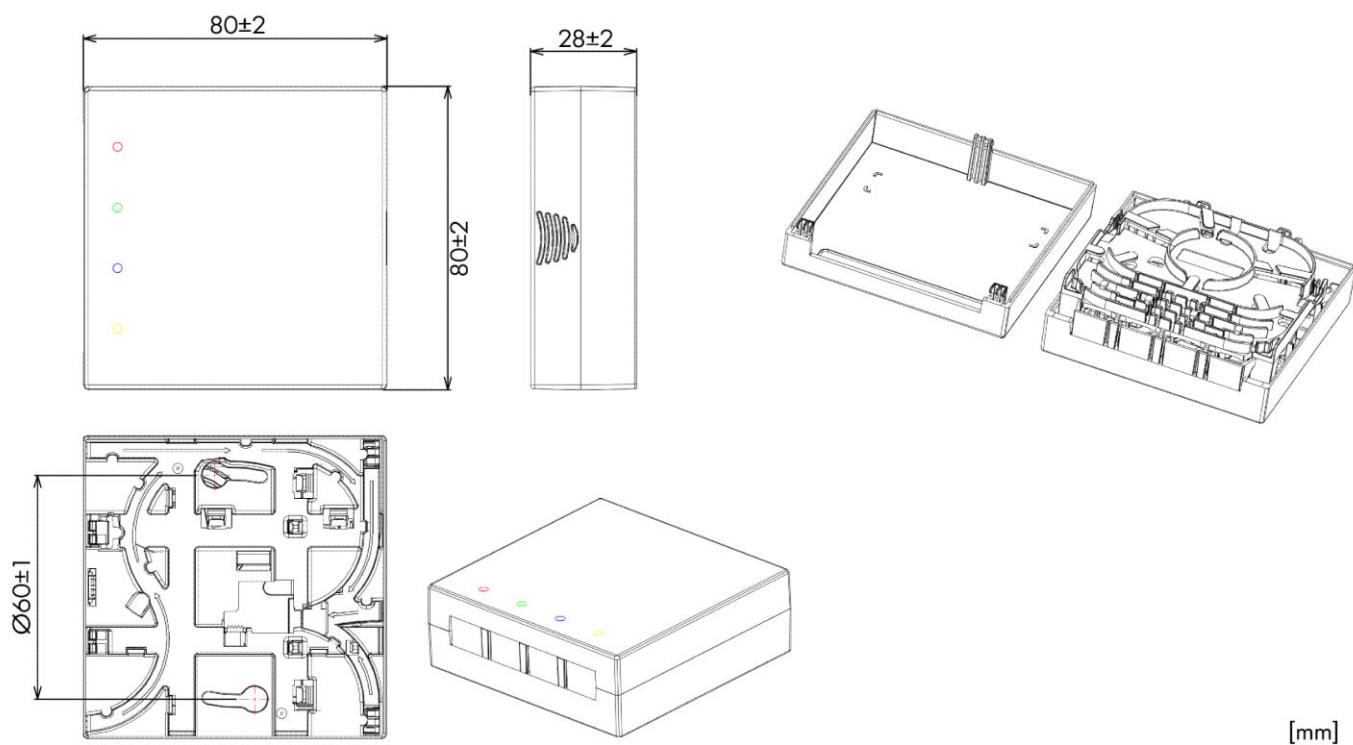

méretrajz: FTTH falon kívüli doboz, sz80xma28xmé80mm 4xLC/APC 8°, OS2

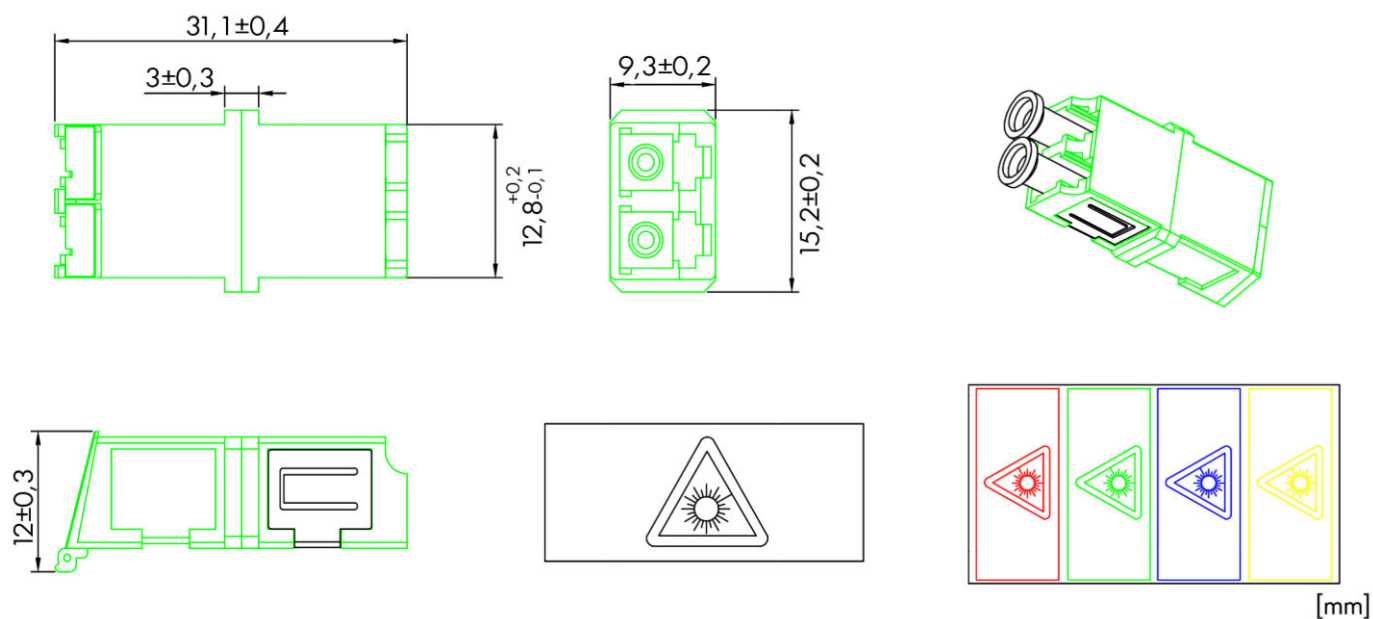

Artikeltabelle

BEZEICHNUNG	BEST.NR.
FTTH falon kívüli doboz, sz80xma28xmé80mm 4xLC/APC 8°, OS2 G657.A2, RAL9010 fehér, kötéstartó, zsugorvédő, 2db duplex toldó és 4db pigtail tartozék	HSELDA49MP
Választható tartozék	
Optikai tisztító eszköz LC és MU Használható UPC és APC csatlakozókhoz. Több mint 1000 tisztítási ciklus.	HSELSZT001
Opt. teljesítménymérő beépített lézeres fényforrással (VFL) RJ45 réz kábelteszt. FIGYELEM: Ez egy 2. osztályú lézertermék. Ne nézzen a lézersugárba. A VFL port fedele mindig legyen rajta, HSELSZT003 amikor nincs használatban. Optikai szálak rendszerekkel végzett munka során ajánlott lézer-védőszemüveg használata.	
Opt. patchkábel duplex LC/APC - LC/APC, 9/125µm OS2, LS0H Sárga, 2m	HLP29MM02F
Opt. patchkábel duplex LC/UPC - LC/APC, 9/125µm OS2, LS0H Sárga, 2m	HLP29LM02F
Opt. patchkábel duplex SC/UPC - LC/APC, 9/125µm OS2, LS0H Sárga, 2m	HLP29CM02F